



Wira House, West Park Ring Road,
Leeds, LS16 6QL, UK.
Telephone: +44 (0)113 259 1999
Email: info@bttg.co.uk
Website: www.bttg.co.uk

Date: 08 November 2018

Our Ref: 55671-3
Your Ref: 1510

Page: 1 of 3

Client: Kobefab International B.V.
De Vest 62
5555 XP Valkenswaard
Netherlands

Job Title: Surface Ignition Of Curtains & Drapes (Type B)

Client's Order No: 1510

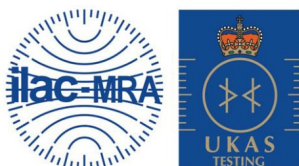
Date of Receipt: 30 October 2018
Date of Test Start: 06 November 2018

Description of Sample(s): One sample identified as follows was received for testing:

Safe CS 300cm, stated to be 100% Trevira CS

Work Requested: We were asked to make the following test:

BS 5867: Part 2: 2008 (2015): Type B Curtains, Drapes and Blinds





TESTING • CERTIFICATION • AUDITING

Wira House, West Park Ring Road,
Leeds, LS16 6QL, UK.
Telephone: +44 (0)113 259 1999
Email: info@bttg.co.uk
Website: www.bttg.co.uk

Date: 08 November 2018

Our Ref: 55671-3
Your Ref: 1510

Page: 2 of 3

Kobefab International B.V.

Sample was identified as follows:

Safe CS 300cm, stated to be 100% Trevira CS

BS 5867: Part 2: 2008 (2015): Type B Curtains, Drapes and Blinds

Pre-treatment

No pre-treatment as this fabric is stated to be inherently flame retardant. BS 5867-2 Clause 6.3 states 'All fabrics shall be tested prior to any cleansing procedure. Except where specified that testing after an approved cleansing or wetting procedure is unnecessary.'

Conditioning

The test specimens were conditioned for at least 24 hours in the standard atmosphere of $60 \pm 5\%$ relative humidity (R.H.) and $20 \pm 2\text{ }^{\circ}\text{C}$.


Testing

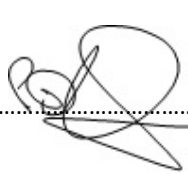
Three specimens from both length and width were tested in accordance with BS EN ISO 15025: Procedure A (surface ignition):2002. The sample was tested at 17°C and 65% relative humidity (R.H.).

Each specimen was subjected to an applied flame using butane and a 15 second flame application time. The results obtained (shown in the table below) were assessed according to the requirements of BS 5867: Part 2:2008 (2015).

Test results relate only to the sample tested.

The results for all tests are given in the table(s) on the following page(s).

Reported by: 
B Bland
Lab Technician

Countersigned By: 
P Doherty
Executive Manager

Enquiries concerning this report should be addressed to Customer Services



1066

Shirley® Technologies Limited. Registered Office: Wira House, West Park Ring Road, Leeds, LS16 6QL.
A company registered in England & Wales with company number 04669651. VAT Number GB 816764800.
BTTG™ and Shirley® are trade names of Shirley Technologies Limited
The supply of all goods and services is subject to our standard terms of business, copies of which are available on request.
Our laboratories are accredited to EN ISO/IEC 17025.

Copyright © 2018 Shirley Technologies Limited. All rights reserved.



TESTING • CERTIFICATION • AUDITING

Wira House, West Park Ring Road,
Leeds, LS16 6QL, UK.
Telephone: +44 (0)113 259 1999
Email: info@bttg.co.uk
Website: www.bttg.co.uk

Date: 08 November 2018

Our Ref: 55671-3
Your Ref: 1510

Page: 3 of 3

Kobefab International B.V.

RESULTS

Sample Ref: Safe CS 300cm, stated to be 100% Trevira CS

BS 5867: Part 2: 2008 (2015): Type B Curtains, Drapes and Blinds

Testing as received.

Specimen No.	Length			Width		
	1	2	3	4	5	6
Flame reached an edge	No	No	No	No	No	No
Hole reached an edge	No	No	No	No	No	No
Flaming debris separated	No	No	No	No	No	No

Requirements

Any "Yes" means fail except if only one specimen fails a further 6 specimens are tested, if the second 6 specimens all pass the result is a pass.

Result: Pass

Conclusion

The fabric meets the Type B performance requirements of BS 5867: Part 2: 2008.

The material should be identified with the manufacturers name, trademark or other identifying mark, the statement 'Flammability complies with the requirements of BS 5867: Part 2, Type B and instructions of any special precautions to be taken concerning care (including cleansing) of the curtain, drape or window blind to be manufactured from the fabric, preferably using an appropriate care labelling symbol in accordance with BS EN 23758 and taking account of the pre-treatment used in this test and the requirements of Clause 4 of BS 5867: Part 2: 2008 (2011). If the fabric is unsuitable for cleansing, this shall be stated.

Note: This report relates only to the samples submitted and as described in the report.

Uncertainty Budget

There is no uncertainty budget associated with BS 5867: Part 2: Type B as no measurements are determined, the pass/fail criteria is assessed visually.



1066

Shirley® Technologies Limited. Registered Office: Wira House, West Park Ring Road, Leeds, LS16 6QL.
A company registered in England & Wales with company number 04669651. VAT Number GB 816764800.
BTTG™ and Shirley® are trade names of Shirley Technologies Limited
The supply of all goods and services is subject to our standard terms of business, copies of which are available on request.
Our laboratories are accredited to EN ISO/IEC 17025.

Copyright © 2018 Shirley Technologies Limited. All rights reserved.